



☐ P.O. BOX 265
OGDENSBURG, NY
U.S.A. 13669-0265

TEL: 888-670-8729 (USA & Canada) or +1-613-686-6675 (Intl)
FAX: 800-561-1970 (USA & Canada) or +1-613-686-6679 (Intl)

info@avtechpulse.com - <http://www.avtechpulse.com/>

☒ BOX 5120, LCD MERIVALE
OTTAWA, ONTARIO
CANADA K2C 3H4

INSTALLATION INSTRUCTIONS FOR THE REPLACEMENT

AC/DC POWER SUPPLY (TPVP103-240042)


ON MODEL AVPP-2-B-N, S/N 12083

The following replacement parts are included in this shipment:


- One TPVP103-240042 AC/DC switching power supply
- Two T0.5A fuses

Note: some photos may not be exactly the same as your unit.


1. Disconnect the power cord from the rear panel.
2. Remove the 4 screws that secure the top cover. Slide the cover off.
3. Unscrew the 2 screws that secure the left side panel. The screw locations are shown in the photo below. Remove the panel.

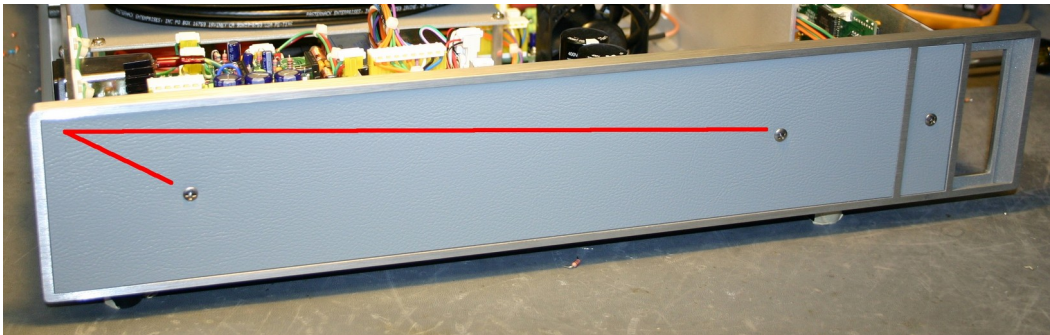


4. Locate the black Total Power TP103-240042 AC/DC power supply, labeled "A" in the photo below:

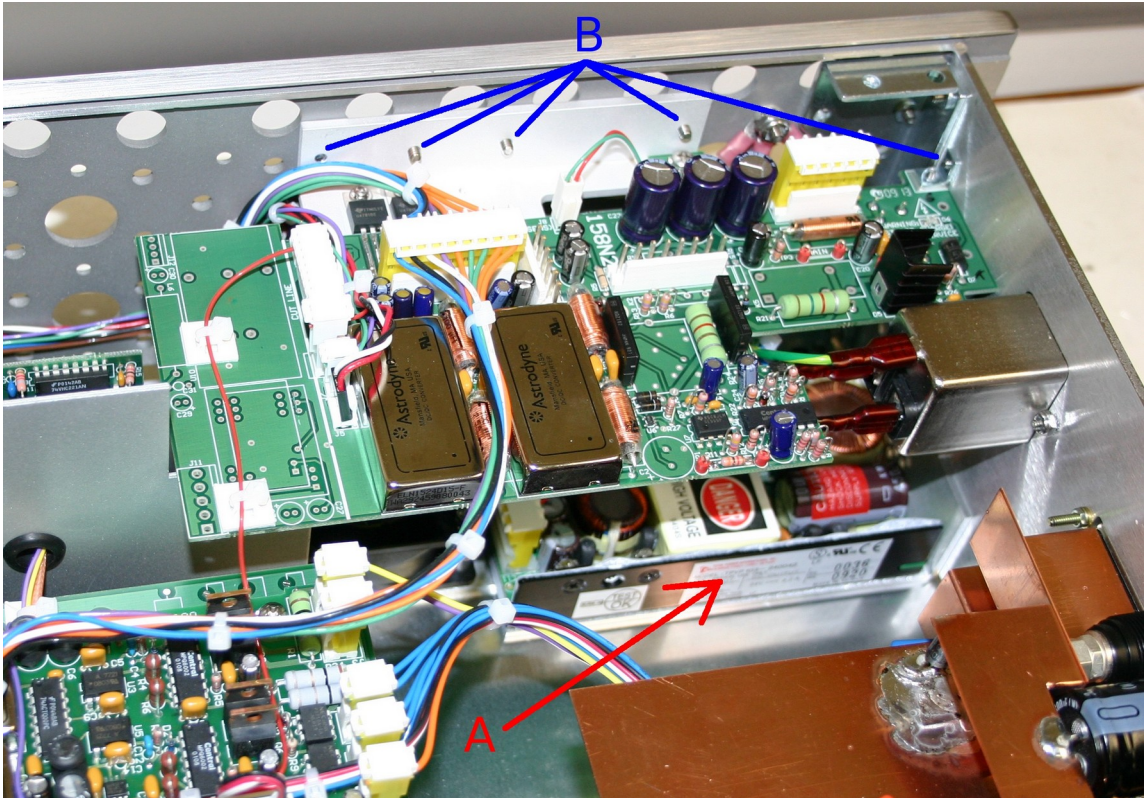

5. To access the defective TPVP103-240042 (“A”), the PCB 158N2 circuit board above it needs to be moved out of the way. Remove the 4 or 5 screws labeled “B” in the photo above.
6. Slide PCB 158N2 a few millimeters towards the front panel, so the the fuseholders come out of their punched holes in the rear panel. You should now be able to move PCB 158N2 out of the way, as shown below:

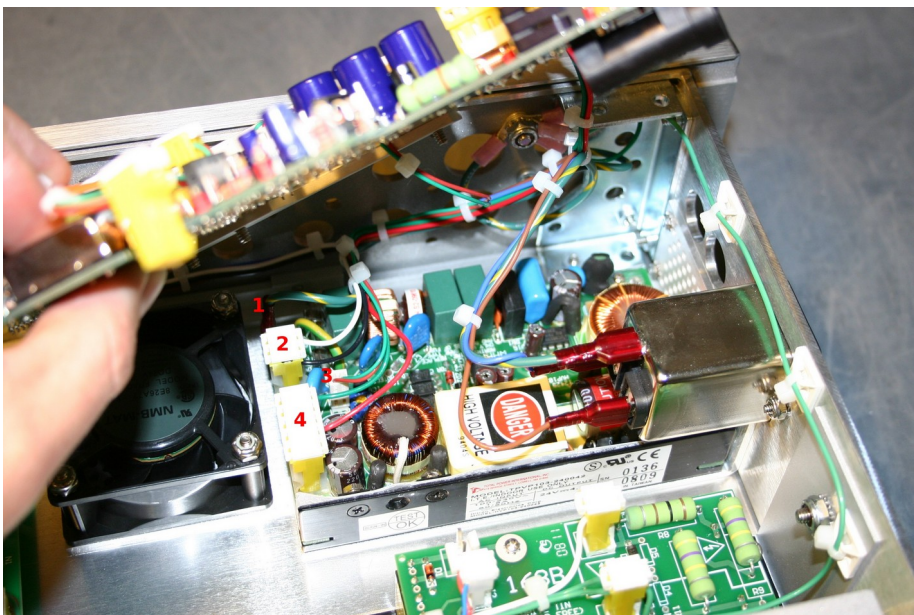

7. Locate the connectors labeled “1”, “2”, “3”, and “4” in the above photo. Slide them off of the mating connectors on the TPVP103-240042 unit.
8. The TPVP103-240042 can now be removed. Locate and unscrew the 4 screws that secure it to the bottom panel, as shown below:

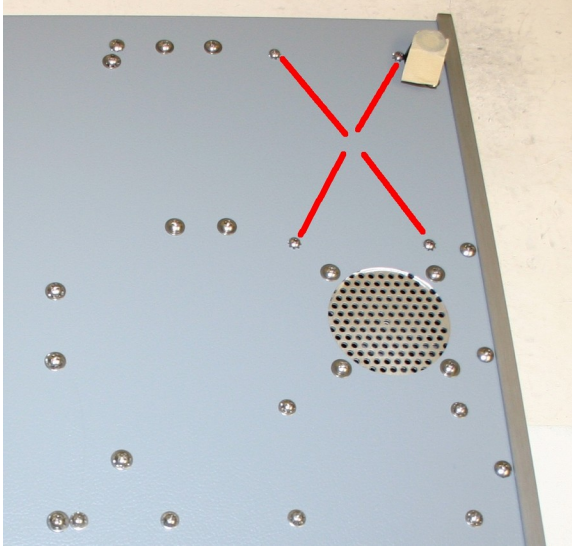

9. Remove the defective TPVP103-240042. Put the replacement TPVP103-240042 in, and secure it to the bottom panel with the 4 screws.
10. Reconnect connectors “1”, “2”, “3”, and “4”.
11. Re-install PCB 158N2 by sliding its protruding fuseholders back into the matching rear panel holes. Re-install the 4 or 5 “B” screws.
12. Re-install the side and top panels.
13. Replace the two 0.5A AC fuses in the drawer below the power cord attachment point with the provided new ones.
14. Re-connect the power cord. Turn on the instrument and test it. It should be operational. If it is not, the instrument will need to be returned to the factory for examination and repair.

If anything is unclear, or further assistance is needed, please contact:

Dr. Michael J. Chudobiak
info@avtechpulse.com
+1-613-686-6675